TEAC **TECHNICAL INFORMATION**

RW-800/CD-RW700/CD-RW2000, Change of Capacitor

No. **0206**
DATE 31st May 2002

Symptom: Various. No display, Suddenly stops, does not boot and so on.
Cause: Defective C07 (Electrolytic Capacitor, 10000µF/16V) on the AUDIO/POWER PCB Assy.
Product quality of the capacitor seems to be low.
Remedy: C07 capacitor has been changed to another manufacturer's one as follows:

	Original	New
Part Number	3C001350 (YEC)	C0037740
Manufacturer	YEC	nichicon

New capacitor has been mounted on the following products.
- RW-800 S/No. 0250001 and higher
- CD-RW700 S/No. 0260001 and higher
- CD-RW2000 S/No. 0140001 and higher

Additional Information
1. It has been reported that "pressure relief vent" of the defective C07 would open like Fig. 1.
2. C07 is fixed by an adhesive bond. This looks like a "leak" but not. See Fig. 2.

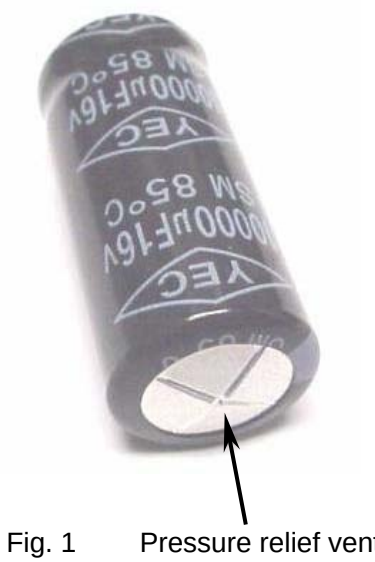


Fig. 1 Pressure relief vent

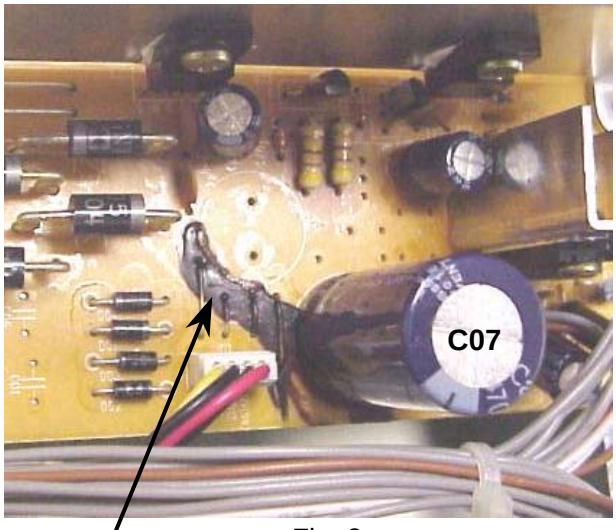


Fig. 2
This is not a leak but an adhesive bond.